


INSTALLATION INSTRUCTIONS

*FOR USE IN STATIC SYSTEMS

MULTISECTION U.L. CLASSIFIED 1½" HOUR*
CURTAIN TYPE FIRE DAMPER
MODEL 150A-B-C

HORIZONTAL INSTALLATION

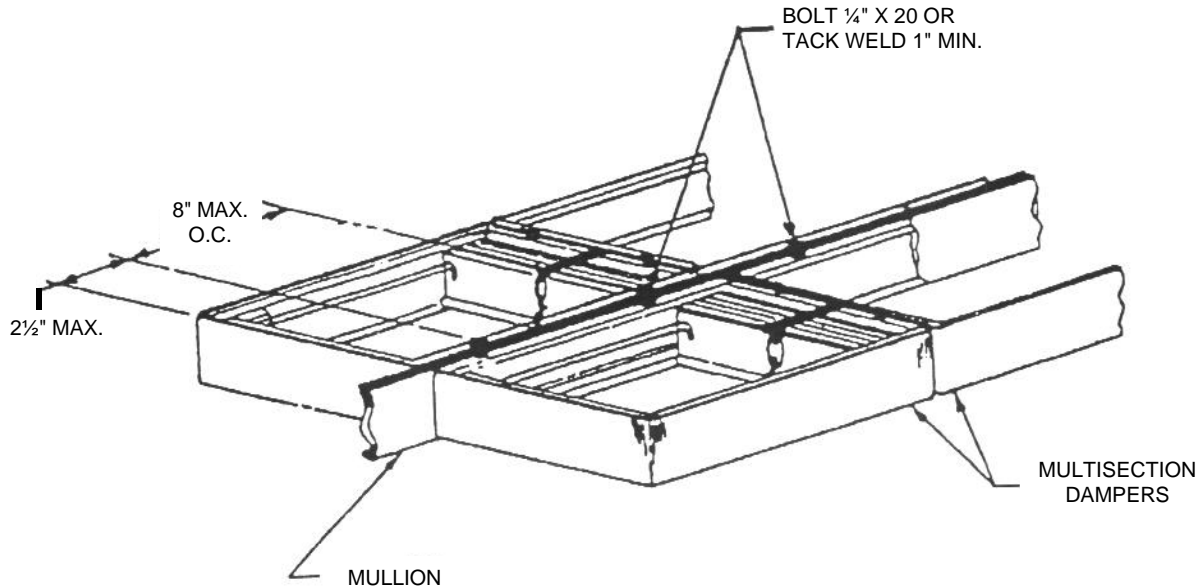

MULLION INSTALLATION DETAIL

Notes: Mullion shall be made of flat 14 gauge galvanized steel and 47/8" wide. Mullion length shall be placed between adjoining damper frame and welded or bolted with 1/4" bolts and nuts using indicated spacing.

Multisection damper assembly 97"W x 42"H are made up from single unit not exceeding 40"W x 40"H (1½ hr. Vertical).

Multisection damper assembly 72"W x 36"H are made up from single unit not exceeding 24"W x 24"H (3 hr. Vertical).

*To maintain Buckley's policy of continuous improvement, we reserve the right to change prices, specifications, ratings or dimensions without notice or obligation. **Manufactured by Sheet Metal Union Local 17.***

MANUFACTURED BY: BUCKLEY ASSOCIATES, INC., HANOVER, MA

MAIN OFFICE

HANOVER, MA
Phone (781) 878-5000
Fax (781) 871-9435

SALES AND WAREHOUSES

NEWINGTON, CT
Phone (860) 666-0555
Fax (860) 666-3035

MANCHESTER, NH
Phone (603) 669-3566
Fax (603) 669-2347

ALBANY, NY
Phone (518) 438-7423
Fax (518) 438-5527



Visit us on the World Wide Web at: <http://www.buckleyonline.com>

98311